
ESTABLISHING PROPER PINION POSITION

DATE: July 14, 1993

TO: All Spicer[®] Axle Distributors

This bulletin represents form 5726 in describing proper pinion position for the mode 60 front and rear axles. This form (5726) is included in the pinion adjustment shim package (701126X, which are included in the drive gear and pinion assembly kits, 707345-2X, or 707345-1X.

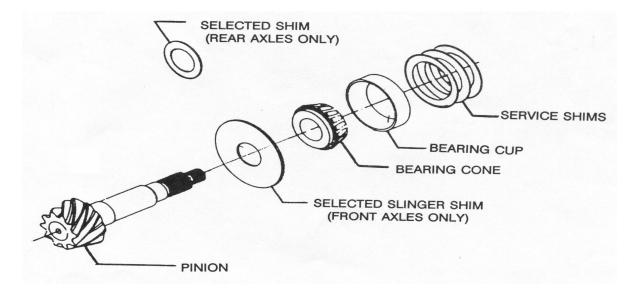

Axle assemblies are manufactured with a selective adjustment shim/slinger between the inner pinion bearing cone and pinion gear head. However, they may be serviced using the selective shim/slinger and/or shims placed in the carrier bore behind the inner pinion bearing cup. Refer to your vehicle service manual for proper procedures in determining the amount of shims required.

If additional copies are needed, please contact your District Sales Manager.

for Hoppe

Joe Hoppe Product Specialist